

Page i

RADIOGRAPHIC INSPECTION OF

CAPACITORS

ESCC Basic Specification No. 2093000

ISSUE 1 October 2002



Document Custodian: European Space Agency - see https://escies.org



LEGAL DISCLAIMER AND COPYRIGHT

European Space Agency, Copyright © 2002. All rights reserved.

The European Space Agency disclaims any liability or responsibility, to any person or entity, with respect to any loss or damage caused, or alleged to be caused, directly or indirectly by the use and application of this ESCC publication.

This publication, without the prior permission of the European Space Ageny and provided that it is not used for a commercial purpose, may be:

- copied in whole in any medium without alteration or modification.
- copied in part, in any medium, provided that the ESCC document identification, comprising the ESCC symbol, document number and document issue, is removed.



european space agency agence spatiale européenne

Pages 1 to 19

RADIOGRAPHIC INSPECTION OF

CAPACITORS

ESA/SCC Basic Specification No. 2093000

See

space components coordination group

	Date	Approved by		
Issue/Rev.		SCCG Chairman	ESA Director General or his Deputy	
Issue 1	September 1994	Tommen's	Aom	
	-		C	



DOCUMENTATION CHANGE NOTICE

Rev. Letter	Rev. Date	Reference	CHANGE Item	Approved DCR No.



TABLE OF CONTENTS

		Deee
1.	SCOPE	Page 4
2.	GENERAL REQUIREMENTS	4
2.1	Applicability	4
2.2	Procedure	4
3.	X-RAY PHOTOGRAPHS	4
4.	DETAILED REQUIREMENTS	7
4.1	Reject Criteria	7
4.2	Ceramic Capacitors	7
4.2.1	Moulding or Coating	7
4.2.2	Terminal Lead Defects	7
4.3	Tantalum Capacitors	9
4.3.1	Tantalum Solid Capacitors	9
4.3.2	Tantalum Non-Solid Capacitors	14
4.3.3 4.4	Hermetically sealed Tantalum Foil Capacitors Plastic Capacitors	16 18
4.5	Mica Capacitors	19
4.6	Filter Capacitors	19
FIGUR	ES	
I	COMPONENT/EXPOSURE ORIENTATION	4
Η	APPEARANCE OF A TYPICAL AXIAL PLASTIC CAPACITOR	6
Ш	UNACCEPTABLE ITEMS FOR CERAMIC CAPACITORS	8
IV	ACCEPTABLE AND UNACCEPTABLE ITEMS FOR TANTALUM SOLID CAPACITORS	11
V	ACCEPTABLE AND UNACCEPTABLE ITEMS FOR TANTALUM NON-SOLID CAPACITORS	14
VI	ACCEPTABLE AND UNACCEPTABLE ITEMS FOR HERMETICALLY SEALED TANTALUM FOIL CAPACITORS	16

- VII UNACCEPTABLE ITEMS FOR PLASTIC CAPACITORS
- VIII UNACCEPTABLE ITEMS FOR MICA CAPACITORS

18

19



1. <u>SCOPE</u>

This specification, to be read in conjunction with ESA/SCC Basic Specification No. 20900, Radiographic Inspection, contains additional requirements for capacitors which shall be applied to each device.

2. GENERAL REQUIREMENTS

2.1 <u>APPLICABILITY</u>

The following criteria may not be varied or modified after commencement of any inspection stage. Any ambiguity or proposed minor deviation shall be referred to the Qualifying Space Agency for resolution and approval.

2.2 PROCEDURE

All items shall be examined in such a manner that a minimum of handling and movement of the components is involved.


3. X-RAY PHOTOGRAPHS

Each component shall be radiographed once in the directions shown in Figure I.

Figure II shows the appearance of a typical axial plastic capacitor.


FIGURE I - COMPONENT/EXPOSURE ORIENTATION

AXIAL LEADS (FOR CERAMIC, TANTALUM, PLASTIC AND FILTER CAPACITORS)

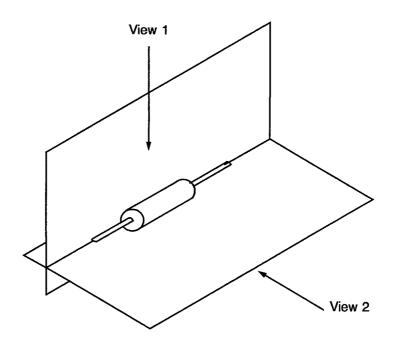




RADIAL LEADS (FOR CERAMIC AND PLASTIC CAPACITORS)

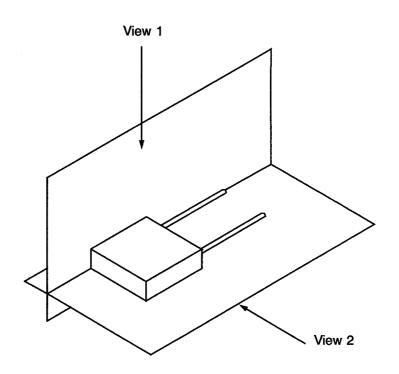

VIEW FOR MICA CAPACITORS

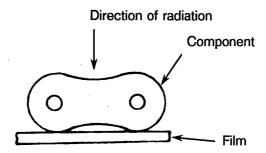


 


FIGURE II - APPEARANCE OF A TYPICAL AXIAL PLASTIC CAPACITOR



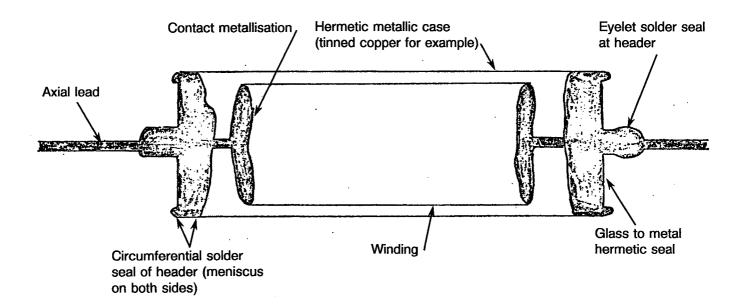

4. DETAILED REQUIREMENTS

4.1 <u>REJECT CRITERIA</u>

A component shall be rejected if it exhibits one or more of the defects listed in any of the following paragraphs.

The drawings of Figure III are included to provide additional explanatory material, but they shall be considered as examples only.

4.2 CERAMIC CAPACITORS

4.2.1 Moulding or Coating

- (a) Thickness of coating or moulding not meeting the requirements of the approved Process Identification Documentation (see Figures III(a) and III(b));
- (b) Capacitor element tilted more than 10° (see Figures III(a), III(b) and III(d));
- (c) Encapsulated foreign material (see Figures III(b) and III(d));
- (d) Cracks, chip-outs or holes (see Figure III(b)).

4.2.2 <u>Terminal Lead Defects</u>

- (e) Gaps between lead and ceramic slug larger than 20% of the soldering interface (see Figure III(c));
- (f) Gaps larger than 20% of the lead nail head diameter 'B' (see Figure III(d));
- (g) Contact length 'K' between terminal lead and ceramic slug less than 75% of the body length (see Figures III(a) and III(c));
- (h) Solder spikes exceeding ceramic slug by more than 0.2mm (see Figures III(a) and III(d));
- (i) Cracks visible between wire and ceramic body (see Figures III(c) and III(d)).



 


FIGURE III - UNACCEPTABLE ITEMS FOR CERAMIC CAPACITORS

FIGURE III (a)

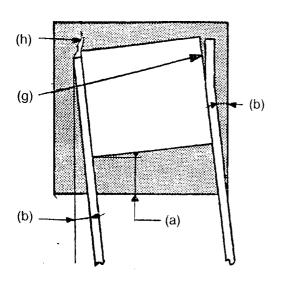

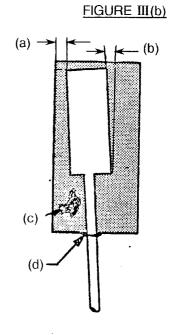



8

1

FIGURE III(c)

FIGURE III(d)

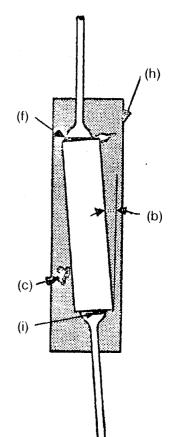

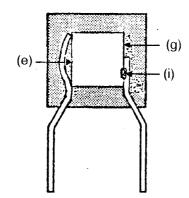



4.3 TANTALUM CAPACITORS

4.3.1 <u>Tantalum Solid Capacitors</u>

(a) Insufficient Solder

Coverage of only one side and part of another. Illustration shows that lower left corner of slug base is not covered.

(b) Solder Ball

Round and dense in appearance. If adhered to case, it will appear to move when second view is taken. If loose, it will probably roll to lower side of can and appear in the same area as it did in first view. Reject 10 mils or larger.

(c) Stressed Lead

Bent during assembly; could cause damage to dielectric at vulnerable lead-slug junction.

(d) Low Solder

Usually the result of too small a solder preform.

(e) Poor Splice Weld

Welds shall be uniform and smooth as well as aligned with the leads.

(f) Cocked Sealing Area

The glass cover shall not be in contact with the tantalum slug.

(g) Cocked Slug

Upper shoulder of slug touching inside wall of case and anode lead bent near slug.

(h) Header Solder Flow

Excess solder flow is indicated by a very dense image along the lower edge of the solder, but feathered along the area closest to the header. To be rejected when flow area approaches top shoulder of slug.

(i) Excessive Solder

Either the upper portion of the slug or the anode lead is obscured by solder.

(j) Insufficient Solder

Extreme case of insufficient solder indicating marginal bond to case.

(k) Broken Lead Weld

Could also indicate poor quality weld.

(I) No Solder in Case

Slug may be on bottom of case due to lack of soler preform during manufacture.

(m) High Slug

Slug "floating" on solder; may be touching header with inadequate solder tubelet closure above lead weld.



(n) Particles

Any irregular particle or pattern of particles exceeding 0.25mm diameter.

(o) No Tubelet Solder

Electrical performance during test may be alright. Normally, tubelet is sealed by hand and this operation could be overlooked.

(p) Solder within Tubelet less than 25%

Normally, a tubelet is filled for 25 to 50% with high temperature solder. Because the filling is done by hand, quantity of solder may vary lot to lot.

(q) Capped Fillet

Under external visual inspection, hollow configurations may have a normal appearance. X-ray inspection, however, may reveal the presence of only a bubble of solder. Reject if inner surface of bubble is above the top of the tubelet or if its cross-sectional thickness is equal to, or less than, the thickness of the tubelet wall.

(r) Excess Fillet

Solder extends below bottom of tubelet.

 
(s) Reflow

Tubelet solder shows concave meniscus; solder has flowed down from the tubelet along anode lead or has formed ball on top of slug.

 



FIGURE IV - ACCEPTABLE AND UNACCEPTABLE ITEMS FOR TANTALUM SOLID CAPACITORS











  

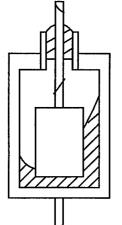




MAXIMUM SOLDER

SOLDER

OFFSET SOLDER

OFFSET SLUG

 ACCEPTABLE ITEMS - MINOR DEFECTS



SOLDER FLOW


Normal solder fillet plus flow down case wall. SOLDER VOID

Slug coverage with solder at least 60%. Void at bottom of slug only if sides are

well covered.


Slug coverage with solder at least 60%. Void at bottom of slug only if sides are well covered.

SOLDER VOID

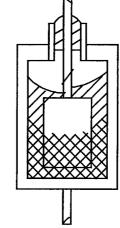

EXCESS SOLDER

Top of slug and anode lead clearly visible.

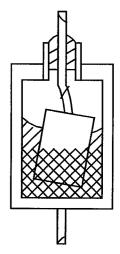

COCKED SLUG


Slight curve of lead, and slug not touching case.




PAGE 12


ISSUE 1

 
UNACCEPTABLE ITEMS





(a)

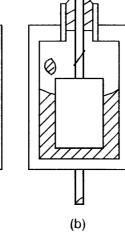


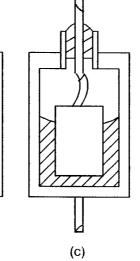


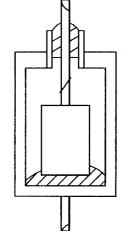

 


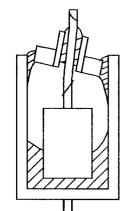

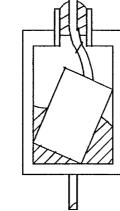

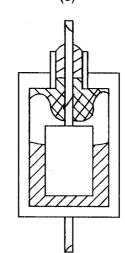



(h)

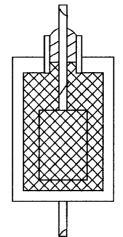


(i)


(d)

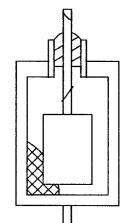


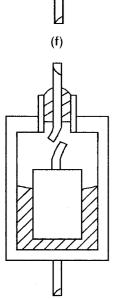


(k)

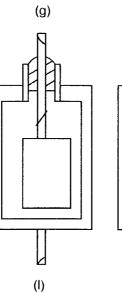

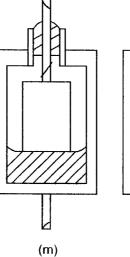


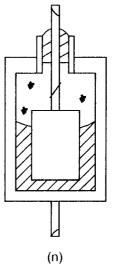

 


L

 
(0)






TUBELET DEFECTS

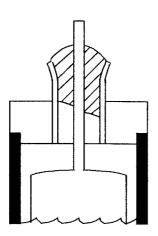


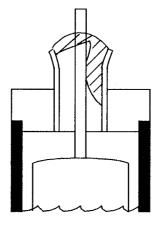





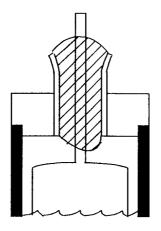

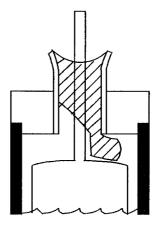

(r)



NOTES 1. References (p) to (s) inclusive relate to Para. 4.3.1.



4.3.2 Tantalum Non-solid Capacitors

(a) Loose Particles


There shall be no loose metallic particles within the case that have a dimension equal to, or greater than, half the narrowest spacing of the anode-to-case (see Figure V (b)).


(b) Physical Damage

There shall be no evidence of a chipped or cracked anode or other physical damage to the tantalum body (see Figure V (e)).

FIGURE V - ACCEPTABLE AND UNACCEPTABLE ITEMS FOR TANTALUM NON-SOLID CAPACITORS

ACCEPTABLE ITEM

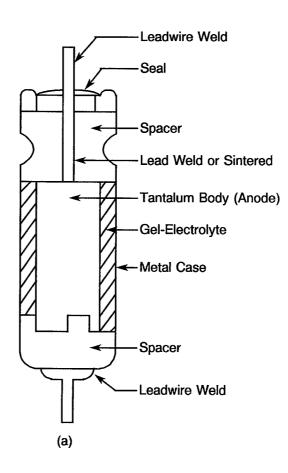

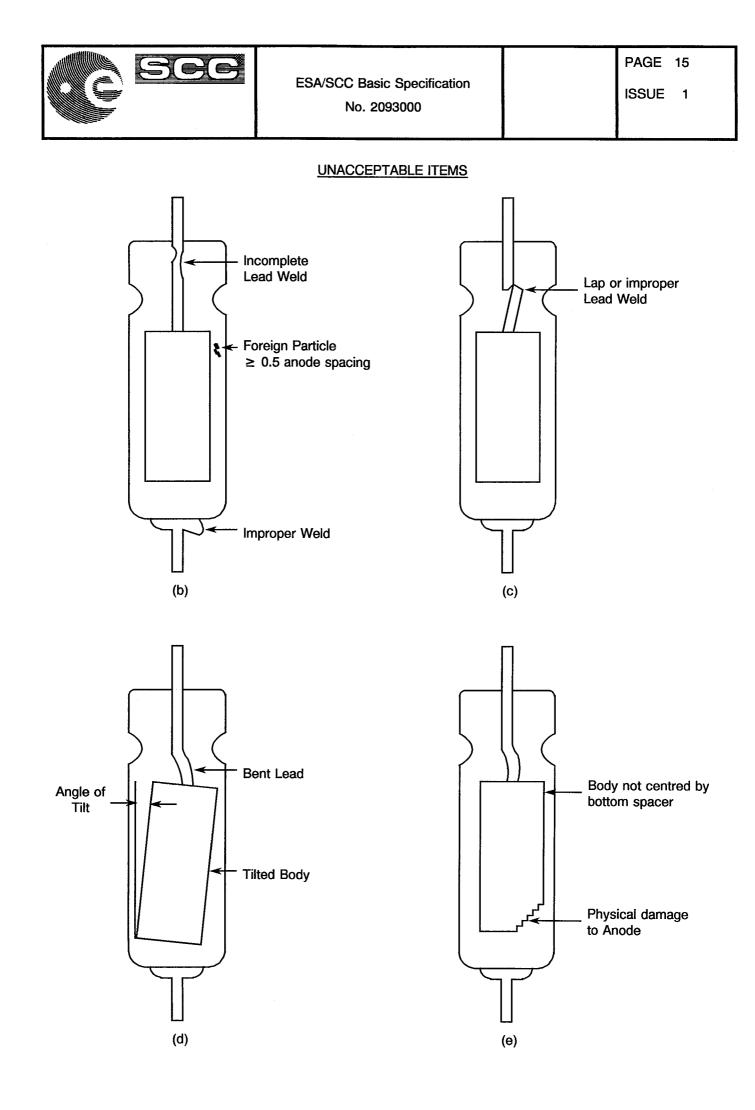



4.3.3 Hermetically Sealed, Tantalum Foil Capacitors

(a) Telescoping of Foil

Although the allowable amount of telescoping will vary with the Manufacturer and case size, noticeable telescoping uncommon to the lot average shall be cause to reject the capacitor (see Figure VI(b)).


(b) Foreign Particles


Metallic foreign particles shall be cause for rejection if any one is greater than 0.125mm in its largest dimension.

(c) Lead Defects


The portion of the lead which is perpendicular to the axis of the capacitor roll less than 0.794mm from the closest edge of the foil, whether the foil is telescoped or not (see Figure VI(d)).

 FIGURE VI - ACCEPTABLE AND UNACCEPTABLE ITEMS FOR HERMETICALLY SEALED TANTALUM FOIL CAPACITORS

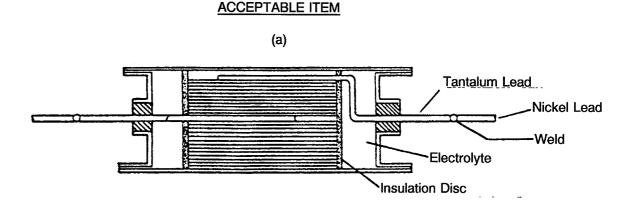





UNACCEPTABLE ITEMS

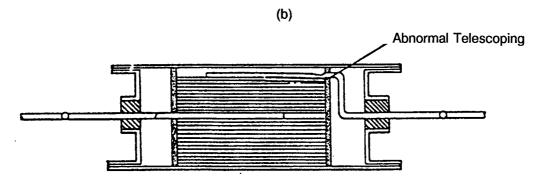

(c)

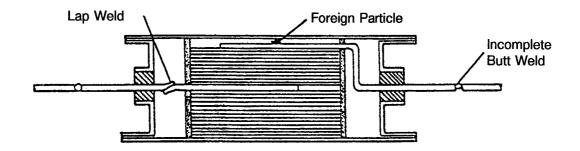

(d)

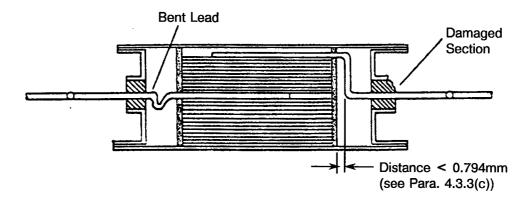




4.4 PLASTIC CAPACITORS

- (a) Visible length of eyelet less than 50% filled with solder.
- (b) Solder in heater/case joint less than 50% of length of joint.
- (c) Loose particles larger than 0.2mm in any dimension.
- (d) Solder spike longer than 0.5mm long.
- (e) Excessively long solder fillet extending beyond edge of winding.
- (f) Apparent asymmetry (i.e., not symmetrical).

FIGURE VII - UNACCEPTABLE ITEMS FOR PLASTIC CAPACITORS

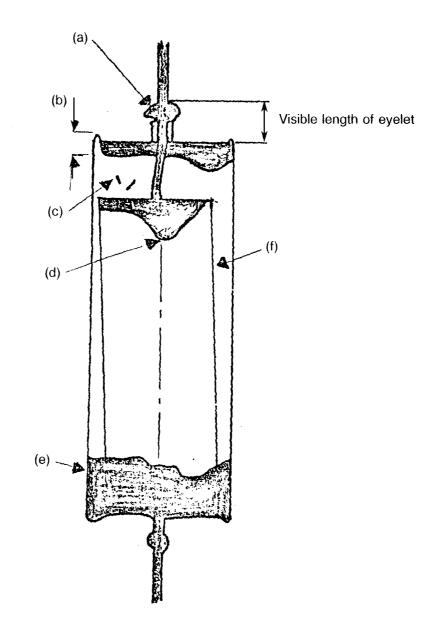


NOTES 1. References (a) to (f) inclusive relate to Para. 4.4.




4.5 MICA CAPACITORS

- (a) Encapsulated foreign material (see Figure WI(a)).
- (b) Thickness of coating or moulding not meeting the requirements of the approved Process Identification Documentation (see Figure VIII(a)).
- (c) Cracks, chip-outs or holes (see Figure VIII(a)).
- (d) Capacitor element offset with regard to end clamp (see Figure VIII(b)).

FIGURE WII - UNACCEPTABLE ITEMS FOR MICA CAPACITORS

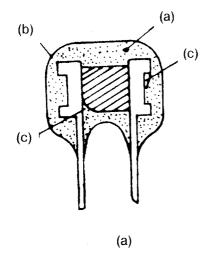

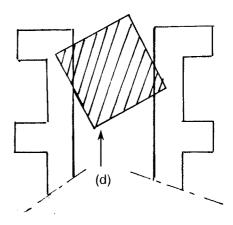

(b)

NOTES

1. References (a) to (d) inclusive relate to Para. 4.5.

4.6 FILTER CAPACITOR

- (a) Holes, cracks or chip-outs on the different elements.
- (b) Foreign material.
- (c) Positioning of the elements not in accordance with the approved production specification.