DOCUMENT CHANGE REQUEST

DCR number 1088	Changes required for: Qualification	Originator: Philippe Gerard
Date: 2017/11/13	Date sent: 2017/05/30	Organisation: SOURIAU
Status: IMPLEMENTED		

Title:	Accessories for Rectangular Connectors 3401/001 and 3401/002 and Connector Savers 3401/020		
Number:	3401/022	Issue:	11

Other documents affected:

Page:

12

Paragraph:

Dimension table for male screw locks

Original wording:

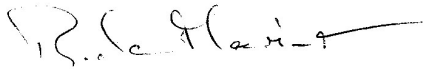
See current ESCC 340/022 Specification Page 12

Proposed wording:

Correction of the wrong values of dimension Q introduced by the DCR 221511
Dimension Q = 3.22/ 3.98 for variants 04,05,51,52,67,68,75 and 76(shell size D without back-shell).
See attached draft of modified ESCC 3401022 Specification.

Justification:

Wrong values Q for variants 04,05,51,52,67,68,75 and 76(shell size D without back-shell).
The use of the dimensions of specification 3401022 does not allow locking of the male screw-lock devices in the female screw-locks.
The dimension Q must be identical to the other shell sizes (E, A, B, C)
The dimension Q must be identical for all shell sizes as is the case for versions used with back-shells (see configuration 1) and the models described in configuration 2 used with or without back-shells.

Attachments:
3401022_issue_11_page12.pdf
Modifications:
N/A
Approval signature:

Date signed:
2017-11-13